

DRAPER

# 200A MMA INVERTER WELDER TIG LIFT

70011



UK  
CA  
CE

These instructions accompanying the product are the original instructions. This document is part of the product, keep it for the life of the product passing it on to any subsequent holder of the product. Read all these instructions before assembling, operating or maintaining this product.

This manual has been compiled by Draper Tools describing the purpose for which the product has been designed, and contains all the necessary information to ensure its correct and safe use. By following all the general safety instructions contained in this manual, it will ensure both product and operator safety, together with longer life of the product itself.

All photographs and drawings in this manual are supplied by Draper Tools to help illustrate the operation of the product.

Whilst every effort has been made to ensure the accuracy of information contained in this manual, the Draper Tools policy of continuous improvement determines the right to make modifications without prior warning.

# 1. INTRODUCTION

## 1.1 SCOPE

This high-tech digital controlled arc welding machine adopts cutting edge inverter technology, controlled by a microchip programmed system. Portable design, easy operation, with a strong and stable performance welder enables application for a variety of ferrous metals such as low carbon steel, medium carbon steel, and alloy steel, etc.

This product is suitable for enthusiasts and tradespersons alike. Any application other than that it was intended for, is considered misuse.

This product is not a toy and must not be used by children or any person with reduced physical, sensory or mental capabilities or lack of experience and knowledge, or people unfamiliar with these instructions.

Local regulations may restrict the age of the operator.

## 1.2 UNDERSTANDING THIS MANUALS SAFETY CONTENT:

**⚠ Warning!** – Information that draws attention to the risk of injury or death.

**Caution!** – Information that draws attention to the risk of damage to the product or surroundings.

## 1.3 EXPLANATION OF SYMBOLS



Warning!  
Read the instruction manual.



Warning!  
Wear suitable welding eye/face protection.



Warning!  
Wear ear defenders (During grinding operations).



Warning!  
Wear protective gloves.



Keep out of the reach of children.



**Warning!**



Danger of electric shock.



Danger of fire.



Danger of explosion.



Danger of fumes.



Danger of ultraviolet radiation.



Danger of burning splashes.



Pressure bottle to be secured by chain.



Fan cooled.



Input current.



Input voltage.



Protection rating.



Thermal overload.



MMA range.



Electrode sizes.



ARC welding (stick), MMA ( Manual Metal Arc) or SMAW (Shielded Metal Arc Welding).



TIG welding (Tungsten Inert Gas) or GTAW (Gas Tungsten Arc Welding).



Machine weight.



WEEE –  
Waste Electrical & Electronic Equipment.  
Do not dispose of Waste Electrical & Electronic Equipment in with domestic rubbish.



Do not incinerate or throw onto fire.



For indoor use only.  
Do not expose to rain.



Class 1 appliance  
(Must be earthed).



UK Conformity Assessed.



European conformity.

## 2. SPECIFICATION

### 2.1 SPECIFICATION

Stock No. ....	70011
Part No. ....	AW200A
Rated voltage .....	230~50Hz
Input current .....	32A
Current range .....	20 - 200A
MMA Electrode size .....	1.6 - 5.0mm
Dinse Type coupling .....	35 / 50
Degree of protection.....	IP21S
Cooling .....	Air (fan)
Insulation class.....	F
Duty cycle:.....	60% @ 200A / 100% @ 160A
Weight (Gross/Net/machine only) .....	6.0/5.3/4.1kg

## 3. HEALTH AND SAFETY INFORMATION

### 3.1 General Safety Instructions

**⚠ Warning! Read all safety warnings and all instructions.** When using electric tools basic safety precautions should always be followed to reduce the risk of fire, electric shock, and personal injury including the following.

Read all these instructions before attempting to operate this product and save these instructions.

#### Electric shock can kill:

- Remove the plug from the socket before carrying out adjustment, servicing, or maintenance.

- Allow 5 minutes waiting time for the capacitors to discharge before removing the panels for any maintenance operations
- Do not touch live electrical parts.
- Never use electrode holders or cables with damaged or deteriorated insulation.
- Keep the working environment, equipment, cables, and clothing free from grease, oil, moisture, and dirt.
- Ensure the welding machine has been correctly earthed and all panels are fitted securely.
- The operator must be insulated from the floor and workbench using a dry insulation mat.
- Wear isolating footwear and gloves that are in good condition, i.e. without holes.
- In hazardous conditions of increased electric shock always ensure a second person is present in case of an accident.
- Never change electrodes with bare hands or damp gloves (for ARC/MMA welders).
- Keep welding cables away from power cables.
- Regularly inspect the condition of the welding, earth, and power cables for signs of damage.
- Do not leave the machine unattended and remove the plug from the socket when not in use.
- Do not use welding cables unsuitable for the amperage.
- Ensure the earth clamp is adjacent to the weld seam, secured to bare metal and when not in use is insulated for safety.
- Keep all equipment well maintained.
- The operator shall prevent gas cylinders in the vicinity of the workpiece from becoming part of the welding circuit.

#### Fumes & Gases can be harmful:

- The welding process generates hazardous fumes as a by-product. Inhalation of these fumes is hazardous to health.
- Keep your head away from the weld to avoid breathing the fumes.
- If welding in confined spaces ensure adequate ventilation and use a fume extractor.
- Welding fumes displace oxygen. The danger of suffocation.
- By-products of welding can react with other chemical vapours to produce a toxic/explosive environment.

#### Welding can cause fire or explosion:

- Arc welding and allied processes can cause fire and explosions and precautions shall be taken to prevent these hazards.
- Before starting a weld ensure the area is clear of flammable materials.
- Remove any inflammables to a safe distance,

especially substances likely to generate a dangerous vapour.

- The welding arc can cause serious burns. Avoid contact with skin.
- Sparks and molten metal are cast out during welding. Take precautions to prevent fire igniting and wear protective clothing.
- Sparks and molten metal can pass through gaps. Be aware that fire can start out of sight. Flammables in a locked cabinet may not be safe.
- Do not weld pressurised containers.
- Do not weld tanks, drums, or other vessels until they have been correctly cleaned/prepared for welding.
- Always have appropriate and fully maintained fire-fighting equipment suitable for the materials used and for use in electrical environments available in close proximity at all times.
- Keep clothing free from oil and grease.
- Wear a hat, flame-proof apron, woolen clothing, gloves, long sleeve tops with closed neck, trousers (without turn-ups) to cover non-slip boots.
- Protective head and shoulder coverings should be worn when overhead welding.
- Avoid taking any fuels with you e.g. cigarette lighters or matches.
- Hot spots and their immediate surroundings should be observed until their temperature has dropped to normal.

#### **Personal Protection:**

- The body should be protected by suitable clothing.
- The use of neck protection may be necessary against reflected radiation.
- Wear safety glasses when chipping, wire brushing, grinding, or when near cooling welds as metal filings or slag can be thrown up. Fully enclosed goggles are advisable.
- Arc machines generate a magnetic field which is detrimental to pacemaker recipients. Consult your doctor before going near welding equipment/operations.
- The UV and IR radiation generated by welding is highly damaging to the eye, causing burns. This can also affect the skin. Protect the eyes and face.
- The face and eyes shall be protected by suitable welding shields equipped with appropriate ocular protection filters.
- Where environments are subject to pedestrians and traffic ensure a protective screen is used to avoid accidental arc glare.
- Do not weld in the vicinity of children or animals and ensure no one is looking before striking up.
- In the welding environment, damaging levels of noise can exist. Wear hearing protection if the process dictates.

- Do not touch hot equipment or metal. Allow the weld time to cool, use the correct tool and wear protective welding gauntlets.
- Wear flame retardant clothing (leather, wool, etc.).
- Take care when adjusting or maintaining the torch that it has had time to cool sufficiently and is disconnected.
- The arc generates
  - ultra-violet radiation (can damage skin and eyes).
  - visible light (can dazzle eyes and impair vision).
  - infra-red (heat) radiation (can damage skin and eyes).
- Such radiation can be direct or reflected from surfaces such as bright metals and light coloured objects.

#### **Gas cylinders:**

- Gas cylinders should be located or secured so that they cannot be knocked over.
- Shield gas containers can explode if damaged. Take care when handling.
- Ensure gas cylinders are shut-off when not in use and between operations.
- Take care that no build-up of gas is permitted to form in confined areas.
- Cylinders must be in an upright position at all times during use and storage.
- The gas cylinder must never come in contact with the electrode.
- Follow the manufacturer's instructions for handling, storing, and using the gas bottle correctly and safely.
- Use the correct equipment to connect the gas bottle to the welding torch.

#### **Limitations:**

- Do not use for:
  - operations in severe conditions (e.g. extreme climates, freezer applications, strong magnetic fields, etc).
  - operations subject to special rules (e.g. potentially explosive atmospheres, mines, etc).
  - operations that require ingress protection greater than IPX0, e.g. in rain or snow, etc.

#### **General:**

- Training should be sought out in
  - the safe use of this equipment;
  - the processes;
  - the emergency procedures;
- Welding power sources are not to be used for pipe thawing.
- Take precautions against toppling over, if the power source shall be placed on a tilted plane.
- All equipment should be kept in good working condition, inspected and, when defective, promptly repaired or withdrawn from service - All equipment

should be placed so that it does not present a hazard in passageways, on ladders, or stairways, and should be operated in accordance with the manufacturer's instructions.

- In the vicinity of an arc, non-reflective curtains or screens shall be used to isolate persons from the arc radiation. A warning, e.g. a symbol for eye protection, should refer to the hazard of arc radiation.

 Stock No.70011 DTL S053 1YF. UK.		Serial No.:		
 		IEC 60974-1		
		20A/20.8V – 200A/28V		
		X	60%	100%
		I <sub>2</sub>	200A	160A
		U <sub>2</sub>	28V	26.4V
		U <sub>1</sub> =230V	I <sub>1MAX</sub> =36.8A	I <sub>1eff</sub> =28.5A
IP21S	 	Class F	  	

## 4. UNPACKING AND CHECKING

### 4.1 PACKAGING

Carefully remove the product from the packaging and examine it for any sign of damage. Check contents against the parts shown in Fig A. If any part is damaged or missing, please contact the Draper Help Line (see back page). Do not attempt to use the product!

The packaging material should be retained during the warranty period, in case the product needs to be returned for repair.

#### Warning!

- Some of the packaging materials may be harmful to children. Do not leave any of these materials in reach of children.
- If any of the packaging is to be thrown away, make sure they are disposed of correctly, according to local regulations.

## 5. TECHNICAL DESCRIPTION



FIG.A

- ① Indicator for TIG lift welding process.
- ② Indicator for alkaline electrode rod.
- ③ Indicator for acid electrode rod .
- ④ Display.
- ⑤ Indicator for hot start.
- ⑥ Indicator for arc force.
- ⑦ Indicator for VRD (Voltage Reduction Device).
- ⑧ Power indicator.
- ⑨ Function Potentiometer.
- ⑩ Welding process selection.
- ⑪ Transport handle.
- ⑫ Positive coupling.
- ⑬ Negative coupling.
- ⑭ Earth clamp.
- ⑮ MMA welding electrode holder.
- ⑯ On/off switch.
- ⑰ Power cable.
- ⑱ Face mask.
- ⑲ Hammer/brush.

**Note:** For details of our full range of accessories and consumables, please visit [drapertools.com](http://drapertools.com)

## 6. ASSEMBLING THE WELDER

Make sure the power supply information on the machine's rating plate is compatible with the power supply you intend to connect it to.

### A suitable plug must be fitted by a qualified electrician.

This machine's wiring has insulation stripped in preparation for wiring a 32A plug (not supplied).

It is designed for connection to a 32amp power supply rated at 230V AC.

Because it is constructed mostly of metal parts, it is a Class 1 machine; meaning, it must have an earth connection in the power supply. This is to prevent electrocution in the event of a failure.

**Note:** Remove the plug from the socket before carrying out adjustment, servicing or maintenance.

Check that the electrical supply delivers the voltage and frequency corresponding to the welding machine and that it is fitted with a delayed fuse suited to the maximum delivered rated current.

**Note:** The welding machines are set to the highest voltage at the factory.

### 6.1 DTi—Digital Technology Inside



Draper Tool's newest models of welding machines contain the latest digital technology, integrated into every element of the machine's control, improving every aspect of performance.

#### More Functions

Internal micro-processors combined with digital circuitry allow more functions to be managed within a single machine, resulting in highly sophisticated machines which are compact and lightweight.

#### Superior Performance

Digital signal stabilisation maintains the machine settings for optimum performance during use, automatically adjusting to humidity, temperature and other environmental factors to ensure superior welding performance in any conditions.

#### Precision Control

Digital technology enables various machine settings to be applied with a high level of accuracy, giving the user precision control of every element of their welding.

## 7. SETTING THE WELDER

### 7.1 GENERAL

This medium weight, portable welder requires no special lifting instructions, however, it contains dedicated circuitry and must be handled with care. The welder is designed to weld with coated consumable electrodes (MMA), using lift arc start with manually fed filler wire (TIG).

**Note:** Although the tungsten electrode is classed as non-consumable compared to the filler rod it will be consumed by the TIG process and require re-sharpening and eventually replacing.

### 7.2 LOCATION

Locate the machine close to the correct power supply and allow a 500mm air gap around to ensure sufficient ventilation. There are two cooling fans located in the rear of the machine housing which must be kept clear. Equally, ensure no debris can be drawn into the machine.

Make certain the location does not pose any hazards as detailed in the safety instructions, before attempting to start the machine.

**Note:** Refer to the rating label for energy input details.

For TIG operations, ensure the gas bottle is securely mounted and in a vertical position according to the manufacturer's instructions.

**⚠ Warning!** Remove the plug from the socket before carrying out adjustment, servicing or maintenance.

### 7.3 TIG (TUNGSTEN INERT GAS) — FIG. 1

A suitable gas supply pressure regulator will be required to connect the hose to the TIG torch.

Attach a TIG torch to the front panel coupling (17), plug in and twist to lock.

Attach the earth clamp into the '+' coupling (12).

**Caution:** For shield gas always use Argon/Argon CO2 mix.



FIG. 1

## 7.4 MMA (MANUAL METAL ARC)

### Installation method

- Connect the power cable to the rated input power.
- The primary cable should be tightly connected to the correct socket to avoid oxidation.
- When welding with an **ACID rod**, electrode holder connect to “+” (12), earth clamp connect to “-” (13).
- When welding with an **ALKALINE rod**, electrode holder connect to “-” (13), earth clamp connect to “+” (12).

## 8. BASIC WELDING OPERATION

NOTE: Although this machine is medium weight and portable take care with additional items i.e. gas bottles etc. Do not manoeuvre over people's heads.

### 8.1 WELDING TYPE SELECTION - SWITCH – FIG.2

- **TIG** (GTAW) Gas Tungsten Arc Welding.
- **MMA** (ACID ROD) **C.C** indicates the machine works under constant current mode.
- **MMA** (ALKALINE ROD) **C.V** indicates the machine works under constant voltage mode.

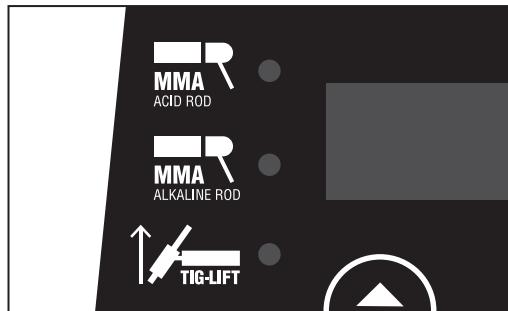


FIG. 2

#### Note:

**Acid electrode** : Acid welding rods are often used when welding general structural parts, that results in nice weld surface, little splash, lower fumes and economical way of welding.

**Alkaline (basic) electrode**: The mechanical properties and crack resistance of alkaline rods is better than acid rod, thus often used when welding important structural parts by sacrificing process performance.

**Note:** Welding is a mix of science and art and due to the complex principles and vast differences in parameters (ie. Material type, position, condition etc.) That information is well beyond the scope of this manual.

Draper Tools suggest training be obtained from a third party or refer to a suitable reference book on the subject additionally; nothing can beat practice using the welder

on scrap material to get a better understanding.

## 8.2 POTENTIOMETER – FIG. 3

Function Potentiometer (9): this button is used for:

- Power ON / OFF
- Hot start
- Arc force setup and adjustment
- VRD selection
- Welding current adjustment

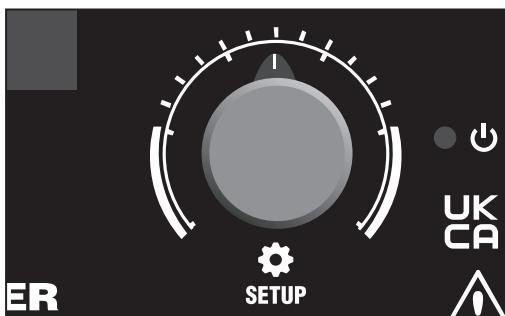


FIG. 3

### 8.3 SETUP

Long press button (9) for 0.5 second to turn on the welder.



Display shows the welder is processing self test at initiating. Checking the welders condition, including heater temperature: T28°C.



And main circuit board voltage: V15.



Press button (10) to select desired electrode rod. The acid rod and alkaline rod.

**Note:** HOT START & ARC FORCE only workable under MMA C.C mode.

#### HOT START

Long press button (9) to set up for HOT START. When indicator (5) is flickering, adjust potentiometer for desired value which ranges from 1 - 9, OFF.

#### ARC FORCE

Long press button (9) to set up for ARC FORCE. When indicator (6) is flickering, adjust potentiometer for desired arc force value which ranges from 1 - 9, OFF.

#### VRD

Under both MMA C.C. & MMA C.V.

Long press button (9) to set up for VRD, When indicator

⑦ is flickering, adjust potentiometer to select ON or OFF option.



#### Note:

This welder has a sleep mode function. 30 minutes of non-use and the welder will go into sleep mode, followed by switching off automatically.



If the electrode sticks on the workpiece, the display shows:



Turn off. Press button ⑨ for 1 second to switch off the welder.

#### Reference Table of Welding Current Setting.

Electrode dia. (mm)	Recommended welding current.	Recommended welding voltage.
1.0	20~60	20.8~22.4
1.6	44~84	21.76~23.36
2.0	60~100	22.4~24.0
2.5	80~120	23.2~24.8
3.2	108~148	23.32~24.92
4.0	140~180	24.6~27.2
5.0	180~220	27.2~28.8

**Note:** This table is suitable for mild steel welding. For other materials, consult related materials and welding process for reference.

## 8.4 TIG WELDER, TUNGSTEN ELECTRODES - SELECTION & PREPARATION – FIG. 4

The correct selection of tungsten size and type will vary for each application dependent upon amperage, material thickness, equipment and shield gas, however as a general rule for DC output negative electrode machines a 1.6mm thorium or cerium oxide tungsten electrode will suffice.

The selection of the ceramic shroud is based on the tungsten electrode and should be 4 to 6 times the tungsten's diameter. For example a 1.6mm tungsten could be used with a No.4 (6.4mm) ceramic shroud, a No.5 (8.0mm) or at the maximum a No.6 (9.8mm).

There are a variety of different tungsten electrodes available with the most common categories underlined:

**Note:** The alloy content shown are a guide but generally range between 1% to 4%.

Before welding can commence the electrode must be prepared, i.e. the tip ground to a suitable point.

If using a grinding wheel, a dedicated abrasive wheel must be used to prevent contamination of the tungsten. The tip must be ground straight, i.e. perpendicular to the grinder's drive spindle.

**Note:** For DC welding the tip should be ground into a point to help produce a stable arc.

The general rule is to grind the point's length to match the electrodes diameter (A).

However for low amperage/smaller diameter electrodes the points length should be double the electrodes diameter (B).

With AC welding you may find the tip forms itself into a balled configuration.

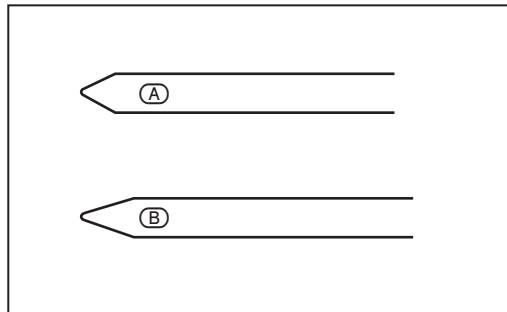


FIG. 4

**Note:** During the grinding process thorium alloy tungsten can release alpha ( $\alpha$ ) dust particles and in some instances beta ( $\beta$ ) and gamma ( $\gamma$ ) particles. Avoid inhalation as they act as a carcinogen.

In addition to dust protection, safety goggles must be worn to protect eyes from sparks and debris thrown up by the grinder.

Selection of the appropriate specification electrode is important to achieve a good quality weld. Seek guidance if unsure of selection.

## 8.5 MACHINE OPERATION

No TIG filler wire is supplied with this machine. For details of our full range of accessories and consumables, please visit [drapertools.com](http://drapertools.com).

Prepare the joint(s) to be welded. Select the electrode suitable for the application and insert it into the electrode holder as described in the manufacturers literature.

The tungsten should extend 3-6mm past the end of shroud but no greater than the gas shroud diameter.

With the earth clamp, electrode holder and gas bottle connected, connect the machine to the power supply. The power display will illuminate as confirmation. Set the amperage adjustment appropriate to the selected electrode size.

Secure the earth clamp to a clean sound section of the

parent metal in the vicinity to the intended weld. With all safety equipment in place and personal protective clothing on begin welding.

**Note:** Ensure the gas bottle regulator is open.

Open the torch gas control valve (where fitted).

Lower the electrode down toward the parent metal.

Allow the tip of the tungsten to touch the workpiece and carefully lift again, the arc will be established and welding can commence.

## 8.6 ARC WELDING, FILLER ROD (ELECTRODE) SELECTION – FIG. 5

The correct selection of electrode size and type will vary for each application dependent upon material thickness, material type, amperage and equipment, however as a guide the figures below provide an indication.

MMA Electrode	Material Thickness	Amp Range
≤1.6mm	1-1.5mm	≤50A
2.0mm	1.2-3mm	45 - 75A
2.5mm	2-5mm	75 - 110A
3.25mm	4-8mm	100 - 150A

With the MMA welding process the arc created between the work piece and the consumable electrode rod melts the parent metal and the filler metal in a weld pool.

The electrode's flux coating reacts during this process and develops into a shield gas protecting the weld bead. Part of this reaction leaves a trail of slag which solidifies behind the weld pool protecting the weld as it cools.

The most common varieties of electrodes are cellulosic, rutile and basic, the latter two being the most general purpose.

Selection of the appropriate specification electrode is important to achieve a good quality weld. Seek guidance if unsure of selection.

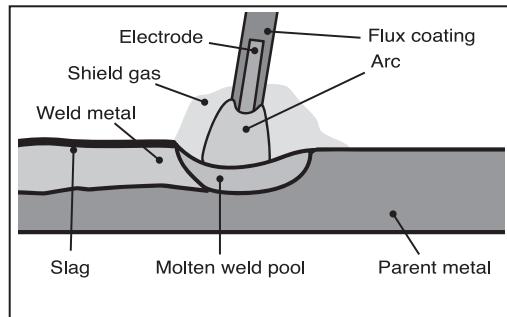


FIG. 5

## 8.7 MMA/ARC MACHINE OPERATION – FIG. 6

Prepare the joint(s) to be welded.

Select the electrode suitable for the application and

insert into the electrode holder (15) while pressing lever (15.1).

With the earth clamp and electrode holder connected, connect the machine to the power supply. The power display will illuminate as confirmation. Set the amperage appropriate to the selected electrode size.

Secure the earth clamp to a clean sound section of the parent metal in the vicinity to the intended weld.

With all safety equipment in place and personal protective clothing on begin welding.

Lower the electrode down toward the parent metal and strike the arc.

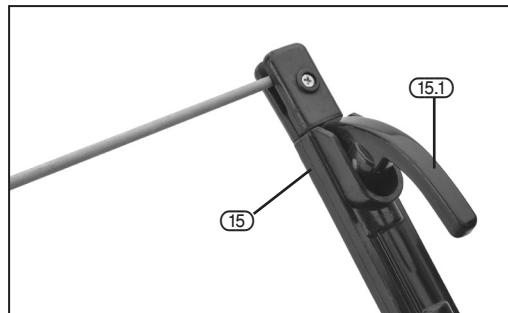


FIG. 6

## 8.8 DIRECTION OF WELD – FIG. 7

Strike the initial arc perpendicular to the parent metal before moving the electrode holder in the direction of travel 20-30° (Z,Y axis) and tilt it 20-30° (Z,X axis).

Maintain a constant gap between the electrode tip and the weld pool of approximately 1 to 1.5 times the diameter of the electrode for a stable arc. This machine is equipped with two additional features 'Arc Force' and 'Anti-Stick' to ensure smooth welding and reduce the instances of the electrode becoming stuck to the parent metal.

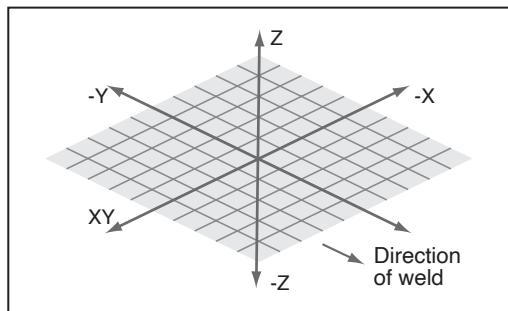


FIG. 7

Definition:

### ARC FORCE

The machine will automatically create a specific overpower when the electrode is too near, forcing it back

Colour Code Band	Content	Composition	Comments
White	0.7-0.9%	Zirconium Oxide contamination resistance.	Predominantly used for AC welding due to its resistance to tungsten spitting and ability to retain a rounded profile tip.
Red	1.8-2.2%	Thorium Oxide	Long life DC welding tungsten alloy providing improved ignition properties and a stable arc. See HSE guidelines.
Grey	1.8-2.2%	Cerium Oxide	Capable of AC/DC welding with reduced slag deposits.

to help avoid the risk of sticking.

#### ANTI-STICK

The machine will automatically reduce the intensity of the current in order to aid quick and simple separation of the electrode and parent metal.

The position of the electrode is critical to the arc and the end result. Achieving a good weld will take practice.

For more detailed information refer to a welding book and/or seek training on the subject.

Use of an anti-spatter spray Draper stock No.05709 will help to achieve a cleaner finished weld. This welding power source has a maximum material thickness capability of 5mm.

#### VRD.

The VRD function fulfils the purpose of drastically reducing the harm which may result to a person from inadvertent contact with the electrode during non-welding pauses.

### 8.9 THERMAL CUT-OUT

If welding for extended periods the thermal cut-out will activate prohibiting use of the machine until sufficiently cool.

**Attention:** After completion of any welding task leave the unit connected to the power supply for a sufficient period to allow the cooling fan to continue working.

### 8.10 DEFINITION:

#### DUTY CYCLE:

Duty Cycle is a percentage of 10 mins. in which a machine can operate at a rated load without overheating and interruption from the thermal cut-out device.

**Example: 150A @ 30% Duty factor**



150A welding for 3 minutes



7 minutes down time

**Example: 95A @ 100% Duty factor**



95A continuous welding

To increase the operation time, reduce the amperage.

**Note:** The heating tests have been carried out at ambient temperature and the duty cycle (duty factor) at 20°C has been determined by simulation

#### ARC WELDING:

Fusion welding in which heat for welding is obtained from an electric arc.

#### MANUAL METAL ARC (MMA welding):

Also known as **SMAW** (Shielded metal arc welding).

Metal-arc welding† with straight covered electrodes of a suitable length and applied by the operator without automatic or semi-automatic means of replacement. No protection in the form of gas from a separate source is applied to the arc or molten pool during welding.

†Arc welding using a consumable electrode.

#### TUNGSTEN INERT-GAS (TIG welding)

Also known as **GTAW** (Gas tungsten arc welding)

Gas-shielded arc welding using a non-consumable pure or activated tungsten electrode where the shielding is provided by a shroud of inert gas.

**Note:** Although the tungsten electrode is classed as non-consumable compared to the filler rod type electrode it will be consumed by the TIG process and require re-sharpening and eventually replacing.

## 9. TROUBLESHOOTING

### 9.1 TROUBLESHOOTING

**WARNING:** For your own safety, turn the switch off and remove the plug from the power supply socket.

Error code	Problem	Cause	Solution
	POST Malfunction.	Output short circuit current.	Check if output is short-circuiting or over loaded.
			Check if output diode got short-circuited.
			Check if IGBT damaged.
			Can not be reset or quit.
	Thermal protection.	Temp of heater exceeds 90°C.	Will resume after temp drops below 50°C.
			Long press potentiometer to quit, and restart the device .
	Temp sensor problem.	Abnormal parameter of temp sensor.	Check if the temp sensor unplugged.
			Check correct temp sensor was used.
			Long press potentiometer to quit, and restart the device.
	Program abnormal voltage.	Main circuit system 15V power supply abnormal.	Power switch problem.
			Relay does not work under soft start.
			Long press potentiometer to quit, and restart the device.

**IMPORTANT:** Please note all repairs/service should be carried out by a qualified person.

## 10. MAINTENANCE

### 10.1 MAINTENANCE

Regular inspection and cleaning reduces the necessity for maintenance operations and will keep your tool in good working condition.

Warning: Remove the plug from the power supply. Periodically the welder must be checked as detailed below.

- Check the torch cable and ground cable connections.
- Clean the contact tip and the gas shroud with an iron brush. Replace if worn.
- Clean the outside of the welder with a damp cloth.
- Every time the wire spool is replaced:
- Check the alignment, cleanliness and state of wear of the wire roll.
- Remove any metal powder deposited on the wire feeder mechanism and then dry with compressed air.
- Occasionally test to ensure the thermal cut-out device is operating correctly, i.e. weld for an extended period or on a maximum duty cycle.

- Check the condition of the warning labels.
- Replace any worn parts.
- If the replacement of the supply cord is necessary, this has to be done by the manufacturer or his agent to avoid a safety hazard.

The welder must be correctly ventilated during tool operation. Avoid blocking the air inlets and vacuum the ventilation slots regularly.

Do not use solvents or fuels to clean the product. When not in use, store the product in a safe, dry place.

## 11. WARRANTY

### 11.1 WARRANTY

Draper tools have been carefully tested and inspected before shipment and are guaranteed to be free from defective materials and workmanship.

Should the tool develop a fault, please return the complete tool to your nearest distributor or contact:

Draper Tools Limited, Chandler's Ford, Eastleigh, Hampshire, SO53 1YF. England.

Telephone Sales Desk: +44 (0)23 8049 4333 or:

Product Helpline +44 (0)23 8049 4344.

A proof of purchase must be provided.

If upon inspection it is found that the fault occurring is due to defective materials or workmanship, repairs will be carried out free of charge. This warranty period covering labour is 12 months from the date of purchase except where tools are hired out when the warranty period is 90 days from the date of purchase. This warranty does not apply to any consumable parts, any type of battery or normal wear and tear, nor does it cover any damage caused by misuse, careless or unsafe handling, alterations, accidents, or repairs attempted or made by any personnel other than the authorised Draper warranty repair agent.

**Note:** If the tool is found not to be within the terms of warranty, repairs and carriage charges will be quoted and made accordingly.

This warranty applies in lieu of any other warranty expressed or implied and variations of its terms are not authorised.

Your Draper warranty is not effective unless you can produce upon request a dated receipt or invoice to verify your proof of purchase within the warranty period.

Please note that this warranty is an additional benefit and does not affect your statutory rights.

**Draper Tools Limited.**

## 12. DISPOSAL

### 12.1 DISPOSAL

At the end of the machine's working life, or when it can no longer be repaired, ensure that it is disposed of according to national regulations.

Contact your local authority for details of collection schemes in your area.

In all circumstances:

- Do not dispose of power tools with domestic waste.
- Do not incinerate.
- Do not dispose of WEEE\* as unsorted municipal waste.



\* *Waste Electrical & Electronic Equipment.*